

**Duration of Test: 2 Hours** 

**Date of Examination:** 

**Booklet No.:** 

### CH - 16

### **Chemical Engineering**

	Hall Ticket No.	
Name of the Candidate :		

**Signature of the Candidate** 

**Signature of the Invigilator** 

#### INSTRUCTIONS


**OMR Answer Sheet No.:** 

- 1. This Question Booklet consists of **120** multiple choice objective type questions to be answered in **120** minutes.
- 2. Every question in this booklet has 4 choices marked (A), (B), (C) and (D) for its answer.
- 3. Each question carries **one** mark. There are no negative marks for wrong answers.
- 4. This Booklet consists of **16** pages. Any discrepancy or any defect is found, the same may be informed to the Invigilator for replacement of Booklet.
- 5. Answer all the questions on the OMR Answer Sheet using **Blue/Black ball point pen only.**
- 6. Before answering the questions on the OMR Answer Sheet, please read the instructions printed on the OMR sheet carefully.
- 7. OMR Answer Sheet should be handed over to the Invigilator before leaving the Examination Hall.
- 8. Calculators, Pagers, Mobile Phones, etc., are not allowed into the Examination Hall.
- 9. No part of the Booklet should be detached under any circumstances.
- 10. The seal of the Booklet should be opened only after signal/bell is given.

CH-16-A



#### **CHEMICAL ENGINEERING (CH)**

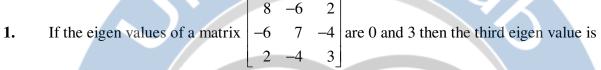

(A) 1

(B) 3

(C) 0

(D) 15

2. The rank of the matrix  $\begin{vmatrix} 3 & 1 & 4 \\ 0 & 5 & 8 \\ -3 & 4 & 4 \end{vmatrix}$  is

(A) 1

(B) 3

(C) 2

(D) 0

3. The gradient of a function  $\phi(x, y, z) = xy + yz + zx$  at the point (1, 2, 0) is

(A) 2i+j+2k

(B) i-2j+k

(C) i + 2j + 2k

(D) 2i+k

4. If  $\phi_1 = 0$  and  $\phi_2 = 0$  are scalar functions then the angle between  $\phi_1$  and  $\phi_2$  is

- (A)  $\cos^{-1} \frac{\nabla \phi_1 \nabla \phi_2}{|\nabla \phi_1| . |\nabla \phi_2|}$
- (B)  $\tan^{-1} \frac{\nabla \phi_1 + \nabla \phi_2}{1 + \nabla \phi_1 \cdot \nabla \phi_2}$

(C)  $\nabla \phi_1 \cdot \nabla \phi_2$ 

(D)  $\sin^{-1} \nabla \phi_1 \cdot \nabla \phi_2$ 

5. The value of  $\oint_C (x^2 - y^2 + 2ixy)dz$ , where C is the contour |z| = 1 is

- (A) 0 (C) π
- (B)  $2\pi i$ (D)  $-\pi i$

6. The integrating factor of the differential equation  $\frac{dx}{dy} + \frac{3}{y}x = \frac{1}{y^2}$ 

(A)  $e^{\log y}$ 

(B)  $e^y$ 

(C)  $y^3$ 

(D) y

7. The Laplace transform of  $\sinh 2x$  is

 $(A) \quad \frac{2}{s^2 + 4}$ 

 $(B) \quad \frac{2}{s^2 - 4}$ 

 $(C) \quad \frac{2}{s^2 + 2}$ 


(D)  $\frac{2}{s^2-2}$ 

Set - A

2

CH



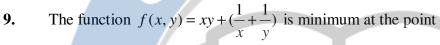

(A) (1,1) (C) (1,2) (B) (0,1) (D) (0,0)

10. If 
$$y(x_i) = y_i$$
,  $i = 0,1,2,3$  and  $h$  the step size then by Simpson  $1/3^{\text{rd}}$  rule  $\int_{x_0}^{x_3} y(x) dx$ 

(A)  $\frac{h}{2}[y_0 + 2y_1 + 2y_2 + y_3]$  (B)  $\frac{h}{3}[y_0 + 2y_1 + 2y_2 + y_3]$  (C)  $\frac{h}{2}[y_0 + 4y_1 + 2y_2 + y_3]$  (D)  $\frac{h}{3}[y_0 + 4y_1 + 2y_2 + y_3]$ 

11. According to Hydrostatic equilibrium, the pressure in a static fluid depends on

(A) Location in cross-section (B) Location in cross-section and elevation

(C) Elevation only (D) None of the above

**12.** The term that is not a part of Bernoulli's equation is

(A) Enthalpy (B) Pressure

(C) Elevation (D) Velocity


13. The pressure difference of a process fluid shown by a U tube manometer is a function of

(A) Height of process fluid in the left arm

(B) Height of process fluid in the right arm

(C) Height of manometric fluid in left arm

(D) Height difference of manometric fluid in both arms.

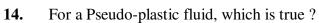

(A) viscosity decreases with time (B) viscosity increases with time

(C) viscosity increases with shear rate (D) viscosity decreases with shear rate

15. For a laminar flow of a fluid in a tube ( $N_{Re}=1000$ ), the fanning friction factor is

(A) 0.16 (B) 0.016

(C) 1.6 (D) 16

**16.** The dimensions of dynamic viscosity are

(A)  $ML^{-1}T^{-1}$  (B)  $M^{-1}L^{-1}T^{-1}$  (C)  $ML^{2}T^{-1}$  (D)  $MLT^{-2}$ 

Set - A 3 CH

		. (1)		0
17.	The	frictional loss in an unseparated bo	oundary	v laver is called
	(A)	Form Friction	(B)	Pressure Friction
	(C)	Dynamic Friction	(D)	Skin Friction
18.	The	pressure drop in a packed bed		
	(A)	Navier Stokes equation	(B)	Euler's Equation
	(C)	Ergun Equation	(D)	Bernoulli's equation
19.	The	velocity profile of a <mark>la</mark> mi <mark>na</mark> r flow o	of a Ne	wtonian <mark>fl</mark> ui <mark>d i</mark> n a tube is
	(A)	Linear (B) Parabolic	(C)	Hyperbolic (D) Sinusoidal
20.		void cavitation in a pump, the main	_	
	(A)	Maintain NPSH	(B)	Do Priming
	(C)	Do Cleaning	(D)	Apply lubricant
21	11			1 11
21.		developed by a centrifugal pump		n <sup>2</sup>
	(A) (C)	$\frac{n}{n^3}$	(B) (D)	n n <sup>-1</sup>
	(C)		(D)	
22.	The	drag coefficient for the flow a past	snhere	e in stokes law regime is given by
	(A)	$16/N_{Re,p}$	(B)	$N_{Re,p}/16$
	(C)	24/N <sub>Re,p</sub>	(D)	$N_{\text{Re,p}}/24$
	(-)	те,р	( )	No.p
23.	The	skin friction loss along the flow o	f 10 m	of the pipe (100 mm diameter) at a velocity
	of 10	Om/s is (given fanning friction factor)	or is 0.	001)
	(A)	20 J/kg	(B)	5 J/kg 10 J/kg
	(C)	40 J/kg	(D)	10 J/kg
24	<b>A</b> o	as the flow devices the linear and	i.	
24.		ong the flow devices, the linear one Venturimeter		Nozzle meter
	(A) (C)	Orificemeter	(B) (D)	Rotameter
	(C)	Officemeter	(D)	Rotanictei
25.	For a	an ideal screen		
	(A)		v large	er than the largest in the underflow
	(B)	_		rger than the largest in the underflow
	(C)	•		ler than the largest in the underflow
	(D)	_	•	maller than the largest in the underflow
Set -	A		4	СН
JCI -	11		-	CII

26.	The	collection efficiency in a cyclone in	crease	se with
<b>4</b> 0.	(A)	decrease in particle density	(B)	decrease in viscosity of gas
	(C)	increase in viscosity of gas	(D)	
	` ′		` '	
27.	For	a particle dropped inside a stagnant	fluid,	the force that shall not act is
	(A)	weight of particle	(B)	drag force
	(C)	centrifugal force	(D)	buoyant force
		/	ı	
28.			_	required is constant for same size ratio?
	(A)	Rittingers Law	(B)	Bonds Law
	(C)	Kicks Law	(D)	Newton's Law
29.	To a	woid centrifuging in a ball mill, the	onerat	ing speed should be
<b>-</b> /•	(A)	Slightly less than critical speed	ореги	ang speed should be
	(B)			
	(C)	Slightly greater than critical speed		
	(D)	Very much larger than critical spe		(0)
30.	The	fluid that shows time dependent rhe	eology	<i>i</i> is
	(A)	Thixotropic Fluid	(B)	Pseudo plastic Fluid
	(C)	Dilatant Fluid	(D)	Binghamplastic Fluid
21	TD1			
31.		mode of heat transfer in which Four		11
	(A) (C)	Conduction Radiation	(B) (D)	Forced Convection Free Convection
	(C)	Radiation	(D)	Tree Convection
32.	The	units of heat transfer coefficient is	Δ	NK.COM
·	(A)	W/m.K	(B)	W/m <sup>2</sup> K
	(C)	J/m.K	(D)	$J/m^2K$
33.	In a	pool boiling phenomenon, the prefe	erred r	regime is
	(A)	Transition Boiling	(B)	Radiative Boiling
	(C)	Film Boiling	(D)	Nucleate Boiling
24	TI	and the second s	1	
34.		s (SI) with a temperature difference	_	medium of heat transfer coefficient 100 °C is
	(A)	5000	(B)	2
	(C)	0.5	(D)	500
Set -			5	СН
5CL -	4 1		J	CII

		. (1)		e
35.		dimensionless group that gives the cnesses is	ratio c	of thermal to hydrodynamic boundary layer
	(A)	Nusselt Number	(B)	Prandtl Number
	(C)	Reynolds Number	(D)	Grashoff Number
36.	The	emissivity of a black body is		
	(A)	1	(B)	>1
	(C)	0	(D)	<1
37.	Acco	ording to Stefan Boltzma <mark>nn</mark> law, the	e emis	sive power of black body is proportional to
	(A)	T	(B)	$T^2$
	(C)	$T^3$	(D)	T <sup>4</sup> , where T is absolute temperature
38.	The	economy of an evaporator is define	ed as	
	(A)	Steam consumed/hr		
	(B)	Water evaporated/hr		
	(C)	Steam consumed/water evaporate	d	40//
	(D)	Water evaporated/steam consume	ed	
39.	In ge	eneral, the major resistance in film	type c	ondensation is
	(A)	Liquid side	(B)	Vapor side
	(C)	Wall side	(D)	Fouling
40.	The	product of Grashoff and Reynolds	numbe	r is called
	(A)	Prandtl Number	(B)	Peclet Number
	(C)	Rayleigh's Number	(D)	Nusselt Number
41.	Ove	rall thermal resistance in a heat exc	hangei	
	(A)	Overall heat transfer coefficient	C	1 1
	(B)	Reciprocal of overall heat transfer	r coeff	icient
	(C)	Overall temperature drop		
	(D)	Temperature difference across the	e wall	
42.	In a	closed system, which is true ?		
	(A)	Only energy exchange		
	(B)	Only mass exchange		
	(C)	Neither mass nor energy exchang	e	
	(D)	Both mass and energy exchange		
Set -	A		6	СН

			e
43.	According to Kelvin Planck statement source is 100 units, then	of seco	nd law, if in a heat engine heat taken from
	(A) Heat delivered to sink should be	100 uni	its
	(B) Work done should be 100 units		
	(C) Work done cannot be 100 units		
	(D) Heat delivered to sink cannot be	100 uni	its
44.		does 40	J work by taking 100 J heat, then the change
	in its internal energy is		
	(A) 140 J	(B)	-60 J
	(C) -140 J	(D)	+60 J
<b>45.</b>	An isentropic process is		
	(A) Reversible	(B)	Adiabatic
	(C) Reversible Adiabatic	(D)	Reversible Isothermal
46.	In a compressible cake		
	(A) Cake resistance is function of tin		
	<ul><li>(B) Cake resistance is function of po</li><li>(C) Cake resistance is not function or</li></ul>		nd time.
	<ul><li>(C) Cake resistance is not function of</li><li>(D) Cake resistance is not function of</li></ul>		nn -
	(D) Cake resistance is not function of	i positic	711.
<b>47.</b>	Partial molar Gibbs free energy is also	called	S+10/
	(A) Enthalpy	(B)	Fugacity
	(C) Chemical Potential	(D)	Entropy
40	The mark and for the state of t	1 - C' 41	
48.	in contact with its vapors is	define tr	ne system of water and toluene (immiscible)
	(A) 1	(B)	2
	(C) 3	(D)	
	UPIQED	$\mathcal{H}$	INN. GUIVI
<b>49.</b>	· · · · · · · · · · · · · · · · · · ·	-	essor (neglecting kinetic and potential energy
	changes), the work done on it is equal		
	(A) 0	(B)	ΔU
	(C) ΔH	(D)	$\Delta S$
50.	Which is true according to principle of	increas	se of entropy?
	(A) $\Delta S$ system>0	(B)	ΔS surroundings>0
	(C) $\Delta S$ system>=0	(D)	$\Delta S$ universe>=0
51.	Which is not a VLE model?	(D)	** *
	(A) Raoults Law	(B)	Hess Law
	(C) Modified Raoults Law	(D)	Henry's Law
Set -	A	7	СН

		: 01	J	eA
52.	Whic	h of the combinations indicate Bul	oble po	oint calculation?
	i.	Calculate yi and T given x and P		
	ii.	Calculate xi and T given y and P		
	iii.	Calculate yi and P given x and T		
	iv.	Calculate xi and P given y and T		
	(A)	i and ii	(B)	ii and iii
	(C)	i and iii	(D)	i and iv
53.	Entha	alpy change of mixing ideal gases w	vould 1	be
	(A)	0	(B)	Positive
	(C)	Negative	(D)	Can't say
			) [	
54.				40% quality is (internal energy values are
	\	xJ/kg and 1200 kJ/kg for saturated b		
	(A)	1400 kJ/kg	(B)	700 kJ/kg
	(C)	600 kJ/kg	(D)	1000 kJ/kg
55.	Whic	th thermodynamic function is called	l as Ge	enerating function?
55.	(A)	Enthalpy	(B)	Internal Energy
	(C)	Entropy	(D)	Gibbs Free Energy
	(0)	Zamopy	(2)	Sides Ties Energy
56.	For v	water gas shift reaction, $CO(g) + I$	H <sub>2</sub> O(g	$\rightarrow$ CO <sub>2</sub> (g)+ H <sub>2</sub> (g), (all species are ideal
	gases	), if the extent of reaction is 0.5		bar pressure, the extent at 20 bar pressure
	would		( <b>P</b> )	1.0
	(A) (C)		(B) (D)	
	(C)	0.23	(D)	1117 0011
57.	Whic	h is not true regarding bypass strea	m ?	NK.COM
57.	(A)	Passes through all stages	/	
	(B)	Affects the final product composit	ion	
	(C)	Skips one or more stages		
	(D)	Affects the component material ba	lances	
<b>7</b> 0			_	1 6 1 06 W 50 1 # D 1 6
58.				les of solute (M W=50 kg/kmol) per kg of 100 °C is 10 moles of solute/kg solvent. If
	10 kg		•	°C, then the weight of the additional solute
	(A)	0.25 kg	(B)	1 kg
	(C)	2 kg	(D)	3.34 kg
		<del></del> 6		
Set -	A		8	СН
_				

		. (1)		
59.				air $(21\% O_2 \text{ and } 79\% N_2)$ in mole percent on $N_2$ -87.1%. Then the mole ratio of $CH_4$ to $O_2$
		e feed stream is		
	(A)	1.05	(B)	0.6
	(C)	0.51	(D)	0.45
60.		he reaction of CO (g) $+(1/2)O_2$ (g) $CO_2$ are $H_1$ and $H_2$ respectively, then		CO <sub>2</sub> , if the standard heats of formation of CO dard heat of the reaction is
		$H_1+H_2$	(B)	$H_1$ - $H_2$
	(C)	$-H_1-H_2$	(D)	H <sub>2</sub> -H <sub>1</sub>
61.	Whic	ch among the fol <mark>lowin</mark> g i <mark>s n</mark> ot a ste <mark>a</mark>	dy sta	te flow reactor?
	(A)	CSTR	(B)	Plug Flow Reactor
	(C)	Batch Reactor	(D)	Tubular Reactor
	`\\			
<b>62.</b>	The 1	units of a first order rate constant		
	(A)	Sec <sup>-1</sup>	(B)	mol lit <sup>-1</sup> sec <sup>-1</sup>
	(C)	lit.mol <sup>-1</sup> sec <sup>-1</sup>	(D)	lit <sup>-1</sup> mol <sup>-1</sup> sec <sup>-1</sup>
63.	In the	e integral method of analysis, for 2A	A→Pro	oducts, a plot of 1/C <sub>A</sub> vs time gives a straight
		of intercept and slope respectively a		
	(A)	C <sub>AO</sub> and k	(B)	1/C <sub>AO</sub> ; 1/k
	(C)	1/C <sub>AO</sub> , k	(D)	C <sub>AO</sub> , 1/k
<b>64.</b>			low ra	te is 100 mol/hr at an initial concentration of
		=10 mol/lit, the space time is	(D)	20.1
	(A)	10 hr	(B)	20 hr
	(C)	30 hr	(D)	40 hr
			Λ	
<b>65.</b>		he reaction A $\rightarrow$ 5R, the fractional		
	(A)		(B)	
	(C)	4	(D)	5
"	Г		1	
66.		l and final concentrations gives	unaer	the plot of $-1/r_A$ vs $C_A$ for a PFR between
	(A)	T/C <sub>AO</sub>	(B)	Т
	(C)	V/F <sub>AO</sub>	(D)	1/T
	(C)	V/I·AO	(D)	1/1
67.			of V g	gives the same conversion as a single PFR of
	volui		(P)	VAL
	(A)	NV	(B)	V/N
	(C)	V	(D)	2NV
Sc4	<b>A</b>		0	CII
Set - L	A		9	СН

<b>68.</b>	In an	ideal CSTR, the concentration of s	pecies	inside the reactor is
	(A)	Same as Inlet	(B)	Same as Exit
	(C)	Not same as Exit	(D)	Can't say
69.	The	half-life of n <sup>th</sup> order reaction in a ba	tch rea	actor depends on
	(A)	Rate constant	(B)	Order of reaction
	(C)	Initial concentration	(D)	All of the above
70.	For s	solid catalyzed reactions, Thiele mod	dulus i	is defined as
	(A)	diffusion rate/intrinsic reaction rate		
	(B)	[diffusion rate/intrinsic reaction rate		
	(C)	intrinsic reaction rate/diffusion rate		
	(D)	[ intrinsic reaction rate/diffusion ra	, ,	
71.	The	units of residence time distribution,	E is	
, 1,	(A)	time	(B)	No Units
	(C)	time <sup>-1</sup>	(D)	time <sup>-2</sup>
	(0)		( <b>D</b> )	
72.	The	slow reactions in gas/porous catalys	t syste	ems are influenced by
	(A)	Pore diffusion	(B)	Surface kinetics
	(C)	Film diffusion	(D)	Particle ΔT
72	The	reactor that quite the most for study	na tha	tringting of solid actalyzad recetions is
73.		Batch reactor	(B)	kinetics of solid catalyzed reactions is  Differential reactor
	(A) (C)	Packed bed reactor	(D)	Mixed Flow reactor
	(C)	I acked ocd reactor	(D)	Mixed Flow reactor
74.	The	resistance to pore diffusion is given	by	
	(A)	Thiele modulus	(B)	Weisz modulus
	(C)	Effectiveness factor	(D)	All of the above
75.		heterogeneous systems, the extra pared to homogeneous system is	term	that comes in the rate expression when
	(A)	Mass transfer term	(B)	Concentration term
	(C)	Temperature term	(D)	None
	` ′		` /	
<b>76.</b>	For o	dilute solutions, diffusivity in liquid	s is pro	oportional to
	(A)	T 3/2	(B)	T
	(C)	$T^{1/2}$	(D)	No effect
		where T is the absolute temperature	e of so	lution.
Set -	A		10	СН
-				

Set -	A		11	СН
85.	The (A) (C)	units of gas hold-up is m <sup>3</sup> m <sup>3</sup> /m <sup>3</sup>	(B) (D)	m <sup>3</sup> /kg kg/m <sup>3</sup>
84.		gas-liquid operation, at very low ga id rains down through the openings Flooding Weeping		cities, the phenomenon in which much of the tray is  Coning  Dumping
83.	As rei	Properties of the second of th	5° diag	onal COV
82.	The (A) (C)	single stage operation among the for Continuous Rectification Fractionation	ollowin (B) (D)	ng is  Differential Distillation  Flash Vaporization.
81.	(A)	separation is possible by distillation,  1 1.5	(B) (D)	value of relative volatility, $\alpha$ is 1.25 2.0
80.	respe			es are 1.796x10 <sup>-3</sup> kmol/s and 0.01052 kmol/s e is 0.1225, then the absorption factor is 1.366 0.889
79.	Whice (A) (B) (C) (D)	· · · · · · · · · · · · · · · · · · ·	ases	er packing material in gas-liquid operations?
78.	The is (A) (C)	analogous dimensionless group in  Reynolds Number  Prandtl Number	(B) (D)	ransfer to Sherwood number in mass transfer  Nusselt Number  Grashoff Number
77.	The (A) (C)	theory that postulates the steady sta Surface Stretch theory Film theory	(B) (D)	centration gradient is  Surface Renewal theory  Penetration theory
		: 01	П	eA

		. (1)		<b>e N</b>
86.	Whi	ch cannot be the unit for mass trans	fer coe	efficient ?
00.	(A)	moles transferred/(area)(time)(pre		
	(B)	moles transferred/(area)(time)(mo		
	(C)	moles transferred/(area)(time)(ma		
	(D)	moles transferred/(area)(time)(ma		
	` /			
87.	In di	rying, if moisture contained by a su	bstanc	e exerts an equilibrium vapor pressure that is
		than that of the pure liquid at the sa		
	(A)	Free Moisture	(B)	Bound Moisture
	(C)	Unbound Moisture	(D)	Equilibrium Moisture
88.	Whi	ch is not recommended for leaching	g opera	ation ?
	(A)	High temperature	(B)	Low temperature
	(C)	High solubility of solute	(D)	Low liquid viscosity
89.	In th	e McCabe thiele diagram, if the x	coordi	nate of the point of intersection of q-line and
			reater	than the x coordinate of the feed point, then
		quality of the feed is		
	(A)		(B)	Superheated Vapor
	(C)	Liquid below bubble point	(D)	Saturated liquid
90.			f the li	quid-gas flow rate is increased, then which is
	true		111	+10
	(A)	Operating line shifts towards equi		
	(B)	Operating line shifts away from ed	quilibr	num curve
	(C)	1 6		ages in the exit liquid atmosp
	(D)	Concentration of absorbed species	sincre	ases in the exit fiquid stream.
91.	Whi	ch of the pressure sensors is non-lin	voor 2	
71.		Liquid column manometer	(B)	Ring Balance
	(A) (C)	Strain gauge on diaphragm	(D)	LVDT type
	(C)	Strain gauge on diaphragm	(D)	LVD1 type
92.	Whi	ch class of temperature measuremen	nt evet	ems applies for widest range of temperature?
/4.	(A)	Solid Expansion type	(B)	Resistance type
	(C)	Thermocouple type	(D)	Liquid Expansion type
	(C)	Thermocoupie type	(D)	Elquid Expansion type
93.	A cc	onstant volume gas thermometer wo	rks on	the principle of
<i>,</i>	(A)	Archimedes principle	(B)	Boyle's Law
	(C)	Charles Law	(D)	Pascal's Law
	(0)	Charles Law	(D)	Tabell 5 Daw
94.	The	generation of emf in thermocouples	s is ext	plained by
- 40	(A)	Seebeck effect	(B)	Ohms Law
	(C)	Stefan Boltzmann Law	(D)	Joule Heating effect
	(0)	Strain Bottemann Bavv	(2)	Journal Chief
Set -	A		12	СН

		. (1)		<b>e N</b>
95.	Whe	en a strip of iron and copper is heate	d	
	(A)	it does not bend		
	(B)	it gets twisted		
	(C)	it bends with iron on concave side		
	(D)	it bends with copper on concave si	ide	
96.		ch is incorrect regarding the first or	der res	sponse system ?
	(A)	$\Delta(Input) = Kp \Delta(Output)$		
	(B) (C)	$\Delta$ (Output)- $\Delta$ (Input)=Kp $\Delta$ (Input)- $\Delta$ (Output)=Kp		
	(D)	$\Delta(\text{Output})=\text{Kp }\Delta(\text{Input})$ , where Kp	is ste	eady state gain
	(D)	Z(Output)=11p Z(Input), where 11p	15 500	ady state gain.
<b>97.</b>	For a	a first order system, after one time	consta	ant, the percent response attained of the final
	valu		/	
	(A)	33.33%	(B)	63.2%
	(C)	75.5%	(D)	100%.
	\			
<b>98.</b>	Whi	ch is not true regarding PI control?		
	(A)	Order of response decreases		
	(B)	Order of response increases		
	(C)	Large Kc values produce very sen		
	(D)	As time constant decreases for cor	istant .	Kc, response becomes more oscillatory
00	TI			
99.	ine	amplitude ratio is defined as	( <b>D</b> )	$(T_{2}^{2})^{2} + 11/V$
	(A)	$K_p/[T_p^2\omega^2 + 1]$ $K_p/[T_p^2\omega^2 + 1]^{1/2}$	(B)	$[T_{p}^{2}\omega^{2} + 1]/K_{p}$ $K_{p}/[T_{p}^{2}\omega^{2} + 1]^{2}$
	(C)	$\mathbf{K}_{\mathbf{p}}/[1_{\mathbf{p}} \ \mathbf{\omega} + 1]$	(D)	$\mathbf{K}_{p}/[1_{p} \omega + 1]$
100.	The	time lag of a first order instrument i	c	
100.	(A)	T	(B)	$(1/\omega) \tan^{-1}(\omega T)$
	(C)	$(\omega) \tan^{-1} (\omega T)$	(D)	$e^{-T}$
101.	The	major drawback of ammonium nitra	ite as a	a fertilizer is
	(A)	High Nitrogen content	(B)	Quick acting nitrate
	(C)	Slow acting ammoniacal nitrogen	(D)	Tendency to cake on storage
102.		ch is incorrect regarding sulfuric aci		
	(A)	Dibasic acid	(B)	Dehydrating agent
	(C)	Reducing agent	(D)	Forms hydrates
103.	Olan	ime ara		
103.	(A)	oms are SO <sub>3</sub> in water	(B)	H <sub>2</sub> SO <sub>4</sub> in water
	(A) (C)	HNO <sub>3</sub> in water	(D)	NO <sub>3</sub> in water
_		0	(-)	0
Set -	A		13	СН

(A) have desired color (B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (B) Dehydrogenation (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>9</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock			. (1)		<b>e N</b>
(A) Na <sub>2</sub> SO <sub>4</sub> (C) NaHSO <sub>4</sub> (D) Lime  105. Sizing is added to paper mainly to (A) have desired color (B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (B) Dehydrogenation (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>2</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/fallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>6</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	104.	In th	e Kraft pulping process, the primar	v mate	erial added to the cooking liquor is
105. Sizing is added to paper mainly to  (A) have desired color  (B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing?  (A) Bleaching (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> )2 (B) CaCl(OCl) (C) Ca(OCl)2 (D) Ca(ClO <sub>4</sub> )2  109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, "API is given by (A) (131.5/S)-141.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock					
(A) have desired color (B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (B) Dehydrogenation (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>9</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		` ′		(D)	
(A) have desired color (B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (B) Dehydrogenation (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>9</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock					
(B) improve the finish (C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	105.	Sizir	ng is added to paper mainly to		
(C) increase penetration resistance to liquids (D) to reduce cost  106. Which operation is not involved in oil processing? (A) Bleaching (B) Dehydrogenation (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(A)	have desired color		
(D) to reduce cost  106. Which operation is not involved in oil processing?  (A) Bleaching (B) Dehydrogenation (C) Refining (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(B)	improve the finish		
106. Which operation is not involved in oil processing?  (A) Bleaching (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock			7	liquids	
(A) Bleaching (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, "API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(D)	to reduce cost		
(A) Bleaching (C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, "API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	40.0	****			
(C) Refining (D) Deodorization  107. Phosphatic fertilizer is graded based on its (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>o</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	106.				
107. Phosphatic fertilizer is graded based on its  (A) P content (B) PCl <sub>3</sub> content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, <sup>0</sup> API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		`		1. [	
(A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(C)	Renning	(D)	Deodorization
(A) P content (C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	107	Phos	enhatic fertilizer is graded based on	ite	
(C) H <sub>3</sub> PO <sub>4</sub> content (D) P <sub>2</sub> O <sub>5</sub> content  108. Bleaching powder is represented by the formula (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	107.	\ \ \			PCl <sub>2</sub> content
Bleaching powder is represented by the formula  (A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock				` ′	
(A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(0)		(2)	1203 (6.110.11
(A) Ca(ClO <sub>3</sub> ) <sub>2</sub> (B) CaCl(OCl) (C) Ca(OCl) <sub>2</sub> (D) Ca(ClO <sub>4</sub> ) <sub>2</sub> 109. Soap may be manufactured by (A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	108.	Blea	ching powder is represented by the	formu	la
(A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock					
(A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(C)	Ca(OCl) <sub>2</sub>	(D)	Ca(ClO <sub>4</sub> ) <sub>2</sub>
(A) hydrolysis of tallow (B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock					<b>a</b> 1 1 •
(B) hydrogenation of vegetable oils (C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	109.	Soap		1	
(C) boiling of vegetable oils/tallow with caustic soda solution (D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		` ′			
(D) oxidation of tallow  110. For petroleum products, °API is given by (A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		` /			
110. For petroleum products, °API is given by  (A) (131.5/S)-141.5 (B) (141.5/S)-131.5  (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is  (A) Net present worth (B) Return on investment  (C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries  (C) Equipment (D) Finished products in stock		` /	• •	th cau	stic soda solution
(A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(D)	oxidation of tallow	Λ	
(A) (131.5/S)-141.5 (B) (141.5/S)-131.5 (C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	110	Ean	natualayan muadyata <sup>0</sup> ADI ia giyan h	Д	IXIK ( .( )I\/I
(C) (145/S)-130 (D) 141.5-(131.5/S) where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	110.				(141.5/\$) 131.5
where S is specific gravity at 60°F/60°F.  111. Profitability measure that considers time value of money is  (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		` ′		` ′	
111. Profitability measure that considers time value of money is  (A) Net present worth (B) Return on investment (C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		` '	· · · · · · · · · · · · · · · · · · ·	` ′	141.3-(131.3/3)
(A) Net present worth (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		WIICI	e o is specific gravity at oo 1700 1	•	
(A) Net present worth (C) Payback period (D) Net return  112. Which does not come under working capital? (A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock	111.	Prof	itability measure that considers time	e value	e of money is
(C) Payback period (D) Net return  112. Which does not come under working capital?  (A) Raw materials (B) Salaries  (C) Equipment (D) Finished products in stock			•		•
(A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock		(C)	_	(D)	Net return
(A) Raw materials (B) Salaries (C) Equipment (D) Finished products in stock					
(C) Equipment (D) Finished products in stock	112.	Whi	ch does not come under working ca	pital ?	
		(A)		` '	
Set - A CH		(C)	Equipment	(D)	Finished products in stock
	Set -	A		14	СН


113.	The	relationship between the effective	annual	interest rate, i <sub>eff</sub> and nominal interest rate r is				
110.	(A)	$i_{eff}$ =ln(r+1)		i <sub>eff</sub> =e <sup>r</sup> -1				
	(C)	i <sub>eff</sub> =lnr-1	` '	$i_{\text{eff}} = e^{r}$				
	(0)	-Cil III	(2)	-cii s				
114.	In a	In a straight line depreciation method, it is assumed that the value of property						
	(A)	decreases linearly with time						
	(B)	decreases exponentially with tim	ne					
	(C)	decreases logarithmically with the	ime					
	(D)	remains constant with time						
115.	Present worth P, of future amount of money F for discrete discounting is							
	(A)	P=Fe <sup>-rN</sup>	(B)	F=Pe <sup>-rN</sup>				
	(C)	P=F(1+i) <sup>-N</sup>	(D)	F=P(1+i) -N				
	\							
116.	Whi	ch is the correct statement for pro	fit ?					
	(A)	Revenue Operating cost	(B)	Revenue Fixed cost				
	(C)	Revenue Total cost	(D)	Revenue Book value				
117.	The unknown cost of desired capacity can be estimated from the known cost of another							
	equipment from the formula							
	(A)	$(\cos t)_1 = (\cos t)_2 [(capacity)_2/(capacity)_1 = (\cos t)_1 = (\cos t)_1$						
	(B) $(\cos t)_1 = (\cos t)_2 [(\operatorname{capacity})_1 / (\operatorname{capacity})_2]$ (C) $(\cos t)_1 = (\cos t)_1 [(\operatorname{capacity})_1 / (\operatorname{capacity})_2]$							
	(C) $(cost)_1 = (cost)_2 [(capacity)_2/(capacity)_1]^{0.6}$ (D) $(cost)_1 = (cost)_2 [(capacity)_1/(capacity)_2]^{0.6}$							
	(D)	$(\cos t)_1 - (\cos t)_2 [(capacity)_1/(capa$	1CI(y)2]					
118.	For	most chemical plants, the ratio of	working	capital to total capital investment is				
110.	(A)	10-20%	(B)	80-90%				
	(C)	50-60%	(D)	1-2%				
	(0)		(2)					
119.	Pito	Pitot tube is used to measure						
	(A)	average velocity	(B)	point velocity				
	(C)	volumetric flow rate	(D)	viscosity				
120.	The cost of heat exchanger is mainly a function of							
	(A)	Area	(B)	Volume				
	(C)	Orientation	(D)	All of the above				
				<u> </u>				
Set -	$\mathbf{A}$		15	СН				



# UPIQPBANK.COM

CHEMICAL ENGINEERING (CH)
SET-A

			_	
Question No	Answer	Question No	Answer	
1	D	61	С	
2	C	62	Α	
3	A	63	С	
4	A	64	В	
5	A	65	С	
6	С	66	В	
7	В	67	С	
8	C	68	В	
9	A	69	D	
10	D	70	A	
11	С	71	C	
12	Α	72	В	
13	D	73	D	
14	D	74	С	
15	В	75	Α	
16	Α	76	В	
17	D	77	С	
18	С	78	В	
19	В	79	A B	
20	Α	80	В	
21	В	81	А	
22	С	82	D	
23	Α	83	Α	
24	D	84	C	1/ 0014
25	Α	85	C	K(C)M
26	В	86	D	$1 \cdot 1 \cdot$
27	С	87	В	
28	С	88	В	
29	В	89	С	
30	Α	90	В	
31	Α	91	В	
32	В	92	С	
33	D	93	С	
34	Α	94	Α	
35	В	95	С	
36	Α	96	D	
37	D	97	В	
38	D	98	Α	
39	Α	99	С	
40	С	100	В	
	_		_	

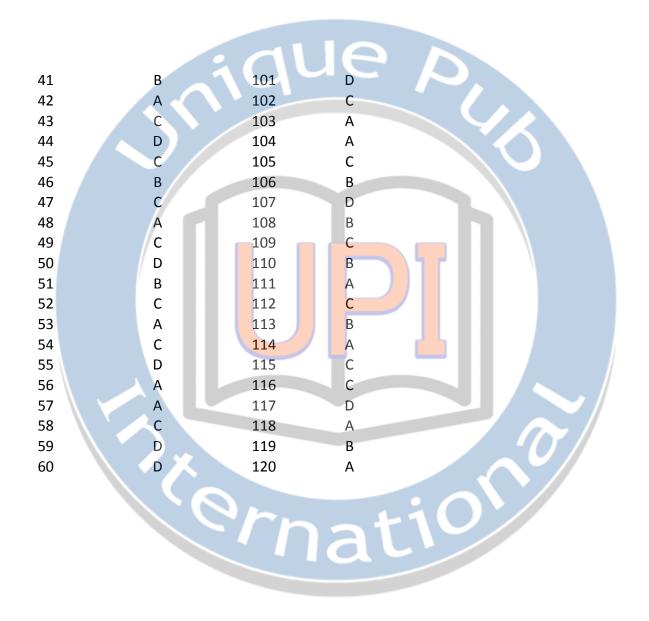

## UPIQPBANK.COM